

Zebra WT6000 Android N LifeGuard Update 23

Release Notes - February 2022

Description

This release contains following software package which is compatible with the WT6000 N product. LifeGuard patches are cumulative and include all previous fixes that are part of earlier patch releases. This release documentation contains the details of this release – features, instructions, component details, part numbers supported and known issues/limitations.

Component Contents

Package Name	Package Description
CFE_WT6000_02-12-29.00-NN-U23-STD.zip	CFE package update

Device Support

USA	SKU	Comment
Standard SKU (1 Gb RAM / 4 Gb Flash)	WT60A0-TS0LEUS	
Premium SKU (2 Gb RAM / 8 Gb Flash)	WT60A0-TS2NEUS	
WT6000,2GB RAM/8GB FLASH, ENGLISH, US	WT60A0-TX2NEUS	
WT6000+KB,2G/8G,St Bat,US	WT60A0-KS2NEUS	Cannot be downgraded to Android L
WT6000+KB,2G/8G,Ext Bat,US	WT60A0-KX2NEUS	
Rest of the World		
Standard SKU (1 Gb RAM / 4 Gb Flash)	WT60A0-TS0LEWR	
Premium SKU (2 Gb RAM / 8 Gb Flash)	WT60A0-TS2NEWR	
WT6000,2GB RAM/8GB FLASH, ENGLISH, WW	WT60A0-TX2NEWR	Cannot be downgraded to Android L
WT6000+KB,2G/8G,St Bat,World	WT60A0-KS2NEWR	- Carmot be downgraded to Anarola E
WT6000+KB,2G/8G,Ext Bat,World	WT60A0-KX2NEWR	

ZEBRA TECHNOLOGIES



New in WT6000 N

- CFE v23 Updates:
 - ❖ CFE WT6000 02-12-29.00-NN-U23-STD.zip
 - Android Security Patch Level: October 05, 2019 (Critical Patch Level: February 01, 2022)

Use the link below to see the Android Security bulletin for more information: https://source.android.com/security/bulletin/

- Updated below mentioned components:
 - WebView 97.0.4692.87
- CFE v22 Updates:
 - CFE_WT6000_02-12-29.00-NN-U22-STD.zip
 - Android Security Patch Level: October 05, 2019 (Critical Patch Level: November 01, 2021)

Use the link below to see the Android Security bulletin for more information: https://source.android.com/security/bulletin/

- Updated below mentioned components:
 - WebView 95.0.4638.50
- CFE v21 Updates:
 - ❖ CFE WT6000 02-12-29.00-NN-U21-STD.zip
 - Android Security Patch Level: October 05, 2019 (Critical Patch Level: October 01, 2021)

Use the link below to see the Android Security bulletin for more information: https://source.android.com/security/bulletin/

New Features

- Added support for ILI9805 display IC for WT6000 devices including downgrade protection.
 This image is backward compatible with existing ILI9805C display (See Notes)
- CFE v20 Updates:
 - CFE_WT6000_02-12-29.00-NN-U20-STD.zip
 - Android Security Patch Level: October 05, 2019 (Critical Patch Level: August 01, 2021)

Use the link below to see the Android Security bulletin for more information: https://source.android.com/security/bulletin/

- Updated below mentioned components:
 - WebView 92.0.4515.115
 - WiFi: FUSION_BA_1_10.0.4.034_N
 - Radio: BA_1_10.0.4.030_N
- SPR43697 Resolved an issue where device was unable to get new AP address and also device processed deauth from unconnected AP.
- CFE v19 Updates:
 - CFE_WT6000_02-12-29.00-NN-U19-STD.zip
 - Android Security Patch Level: October 05, 2019 (Critical Patch Level: May 01, 2021)

Use the link below to see the Android Security bulletin for more information:



https://source.android.com/security/bulletin/

- Updated below mentioned components:
 - WebView 90.0.4430.91
- SPR42945 Resolved an issue where device is experiencing slow WiFi operation when BLE scan/transmit was running on same band.
- SPR43129 Resolved an issue where WLAN and Bluetooth model names were incorrectly displayed as "WCN3680B".
- SPR43281 Resolved an issue where device disconnects the wifi when the ARP Response is not received.

CFE v18 Updates:

- ❖ CFE WT6000 02-12-29.00-NN-U18-STD.zip
 - Android Security Patch Level: October 05, 2019 (Critical Patch Level: February 01, 2021)

Use the link below to see the Android Security bulletin for more information: https://source.android.com/security/bulletin/

- Updated below mentioned components:
 - WiFi FUSION BA 1 10.0.4.032 N
 - WebView 88.0.4324.93
- SPR40628 Resolved an issue where Invalid rates set in CCX Rate IE of TSPEC leads to GTK Rotation failure.
- SPR40178 Resolved an issue where sometimes device didn't respond to pings in suspend state.
- SPR39491 Resolved an issue wherein voice calls intermittently becomes one way when connected to a FT (802.11r) network.
- SPR40705 Resolved an issue where device processes deauthentication/disassociation from non-connected Access Point.
- SPR37268 Resolved an issue where Proxy Service getting killed due to rebinding of proxy call during initial binding.

CFE v16 Updates:

- CFE_WT6000_02-12-29.00-NN-U16-STD.zip
 - Android Security Patch Level: October 05, 2019 (Critical Patch Level: November 01, 2020)

Use the link below to see the Android Security bulletin for more information: https://source.android.com/security/bulletin/

Updated WebView version 85.0.4183.120.

CFE v15 Updates:

- ❖ CFE WT6000 02-12-29.00-NN-U15-STD.zip
 - Android Security Patch Level: October 05, 2019 (Critical Patch Level: August 01, 2020)

Use the link below to see the Android Security bulletin for more information: https://source.android.com/security/bulletin/

SPR39876 - Updated WebView version 81.0.4044.111.



- SPR40014 Added new APIs which can set/unset the configurations for app verification on a GMS device for the SafetyNet security check, Same API's will throw unsupported exception as WT6000 is Non-GMS device.
- SPR39693 Fixed an issue when pairing a second HS3100 by NFC fails.
- SPR39823 Fixed an issue wherein WT6000 does not acquire IP address sometimes when DHCP option 81 is enabled.
- SPR38679 Resolved an issue where Device loses wireless connectivity during roam in screen off state.

• CFE v14 Updates:

- CFE_WT6000_02-12-29.00-NN-U14-STD.zip
 - Android Security Patch Level: October 05, 2019 (Critical Patch Level: May 01, 2020)

Use the link below to see the Android Security bulletin for more information: https://source.android.com/security/bulletin/2020-05-01

- SPR39242- Resolved issue where VMWare MX Service was disabled or lost after update to LI01
- Updated the firmware for fixing Kr00k vulnerability issue seen with Broadcom Wi-Fi chipsets.

• CFE v13 Updates:

- ❖ CFE WT6000 02-12-29.00-NN-U13-STD.zip
 - Android Security Patch Level: October 05, 2019 (Critical Patch Level: November 01, 2019)

Use the link below to see the Android Security bulletin for more information: https://source.android.com/security/bulletin/2019-11-01

- Added support for RS5100 Ring Scanner.
- Added support for WT6000 External Keypad.

Part Number	Model No	Description
KYPD- WT6XANFASM-01	KYPD-WT6X	WT6000 External Keypad Assembly, Alphanumeric and Function, Includes Mounting Cleat

- SPR37767 Resolved an issue wherein scanner stopped working during rapid scanning with hard trigger.
- SPR37584 Fixed an issue where device WiFi not waking up on time to receive the buffered packets from the AP.
- SPR37601 Resolved an Issue where English Ireland(en_IE) and Spanish Mexico (es_MX) locales were not being applied successfully through Stagenow.
- SPR38118 Fixed an issue where disabling Airplane mode via StageNow was not working.
- SPR37434 Fixed an issue wherein the device becomes warm after pushing Wi-Fi configuration through StageNow.
- SPR38531 Added a Bug report menu inside Power Button Menu list.
- SPR37841 Fixed an issue where device WiFi not waking up on time to receive the buffered packets from the AP.

CFE v12 Updates:

- CFE_WT6000_02-12-29.00-NN-U12-STD.zip
 - Android Security Patch Level: October 05, 2019



Use the link below to see the Android Security bulletin for more information: https://source.android.com/security/bulletin/2019-10-01

Updated below mentioned components: For more detail please refer

http://techdocs.zebra.com

- DataWedge version 7.3.26
- EMDK version 7.3.21.2321

• CFE v11 Updates:

- CFE_WT6000_02-12-29.00-NN-U11-STD.zip
 - Android Security Patch Level: August 05, 2019

Use the link below to see the Android Security bulletin for more information: https://source.android.com/security/bulletin/2019-08-01

Updated below mentioned components: For more detail please refer

http://techdocs.zebra.com

- DDT version 1.17.0.9
- StageNowClient version 3.3.1.2000
- Event injection Service version 1.0.0.5
- MXMF version 9.0.4.3
- B2M client included in disabled mode.
- SPR35062 Fixed an issue wherein setting Default Launcher was failing when more than one third party launcher was installed in the device.
- SPR34771 Resolved synchronization issue while checking with accessmanager.
- SPR35928 Resolved an issue where Clock Manager CSP accepts timezone id in "/Etc" Olson format.
- SPR36994 Resolved MX initialization issue wherein EHS was calling MX before completion of MX initialization process.
- SPR36958- Resolved an issue wherein disabling Airplane Mode using PowerKey Manager is not working.
- SPR36768- Resolved an issue wherein EHS Hostname in title was not reflecting updated HostName after device reboot.
- DataWedge version 7.3.25
- SPR37060 Resolved an issue wherein Datawedge was not disabling the scanner upon resume during app transition from background to foreground causing intermittent scanning failures.
- SPR37124 Resolved an issue where in ADF rule with crunch spaces was removing last character from barcode data with space.
- EMDK version 7.3.20.2320
 - SPR36925 Resolved an issue wherein scanner was not available for second app when an ANR or crash occurred on the first app.
- EnterpriseKeyboard version –2.1.1.3
 - SPR34093 Resolved an issue wherein AutoCapitalization was not working when you navigate away from Alpha keyboard prior to typing.



- SPR35603 Resolved an issue wherein Enterprise Keyboard was not visible when external USB keyboard was connected.
- SPR37353

 Enabled remapping of the right-side emoji icon in the EKB, both left and
 right emoji icons will be remapped to same key.
- Scanner Framework version SF 19.57.37.0
 - SPR37175 Fixed an issue wherein Two apps can enable the same scanner without one app releasing it.

CFE v10 Updates:

- CFE_WT6000_02-12-29.00-NN-U10-STD.zip
 - Android Security Patch Level: May 05, 2019

Use the link below to see the Android Security bulletin for more information: https://source.android.com/security/bulletin/2019-05-01

 SPR36830 – Resolved an issue where BT HS3100 voice re-calibration required when other headsets are used.

• CFE v9 Updates:

- CFE_WT6000_02-12-29.00-NN-U09-STD.zip
 - Android Security Patch Level: April 05, 2019

Use the link below to see the Android Security bulletin for more information: https://source.android.com/security/bulletin/2019-04-01

CFE v8 Updates:

- CFE_WT6000_02-12-29.00-NN-U08-STD.zip
 - Android Security Patch Level: March 05, 2019

Use the link below to see the Android Security bulletin for more information: https://source.android.com/security/bulletin/2019-03-01

- Updated below mentioned components:
 - WiFi FUSION_BA_1_10.0.3.019_N
- SPR36111 Resolved an issue where WiFi connection drops and unable to recover till a reboot.

CFE v7 Updates:

- CFE_WT6000_02-12-29.00-NN-U07-STD.zip
 - Android Security Patch Level: February 05, 2019

Use the link below to see the Android Security bulletin for more information: https://source.android.com/security/bulletin/2019-02-01

 SPR36331 – Resolved a device reboot issue where DHCP Option received with more than expected length.

CFE v6 Updates:

- CFE_WT6000_02-12-29.00-NN-U06-STD.zip
 - Android Security Patch Level: January 05, 2019

Use the link below to see the Android Security bulletin for more information: https://source.android.com/security/bulletin/2019-01-01



CFE v5 Updates:

- CFE_WT6000_02-12-29.00-NN-U05-STD.zip
 - Android Security Patch Level: December 05, 2018

Use the link below to see the Android Security bulletin for more information: https://source.android.com/security/bulletin/2018-12-01

CFE v4 Updates:

- CFE_WT6000_02-12-29.00-NN-U04-STD.zip
 - Android Security Patch Level: November 05, 2018

Use the link below to see the Android Security bulletin for more information: https://source.android.com/security/bulletin/2018-11-01

CFE v3 Updates:

- CFE_WT6000_02-12-29.00-NN-U03-STD.zip
 - Android Security Patch Level: October 05, 2018

Use the link below to see the Android Security bulletin for more information: https://source.android.com/security/bulletin/2018-10-01

- B2M client included in disabled mode.
- SPR35849 Resolved an issue wherein KeyProgrammer fails to open via Device settings.

CFE v2 Updates:

- CFE_WT6000_02-12-29.00-NN-U02-STD.zip
 - Android Security Patch Level: September 05, 2018

Use the link below to see the Android Security bulletin for more information: https://source.android.com/security/bulletin/2018-09-01

- Updated below mentioned components:
 - Diagnostic Tool: Version 1.16.0.1
 - OEMConfig: Version 8.1.0.9
 - Enterprise Keyboard: Version 1.9.0.4
 - DataAnalytics Version 3.3.0.1113
- MX, StageNow, EMDK, Datawedge component updates:

Note: For detailed release notes, please refer

http://techdocs.zebra.com

- MX: Version 8.1.0.10
- StageNow Client: Version 3.1.1.1018
- EMDK: Version 6.10.12.1312
- SettingsEULA has been renamed to Zebra Data Services.
- Included Zebra Software License Manager v3.1.1.
- CVE-2018-5383 was corrected preventing unauthenticated BT pairing.
- WiFi FUSION_BA_1_10.0.1.017_N



- SPR34999 Resolved a WLAN disconnection issue in 2.4GHz band with BT operation.
- Datawedge: Version 6.9.49
 - SPR34429 Resolved an issue wherein DataWedge failed to load "default Profile0".
 - SPR34614 Resolved an issue in DataWedge wherein scanner could not be enabled due to quick enabling and disabling of scanner through Intents.
 - SPR34972 Implemented new parameters in scanner_input_plugin API so that the API takes considerably less time to suspend/reenable of the scanner

• CFE v1 Updates:

- CFE_WT6000_P01_NN_02-12.29.zip
 - Android Security Patch Level: August 05, 2018

Use the link below to see the Android Security bulletin for more information: https://source.android.com/security/bulletin/2018-08-01

Component / Description	Version
Product Build Number	02-12-29.00-NN-U23-STD.
Android Version	7.1.1
Linux Kernel	4.1.15
Android SDK Level	25
Platform	Freescale imx6
Bluetooth Stack	Android 7.1.1
Flash Size	4GB/8GB
RAM Size	1GB/2GB
Scanning	19.61.37.0
DataWedge	7.3.34
EMDK	7.3.23.2323
MXMF / OSX	MXMF: 9.4.0.3/ OSX: FSL.71.7.10.1
WiFi	FUSION_BA_1_10.0.4.034_N Application: BA_1_10.0.1.013_N



	Radio: BA_1_10.0.4.030_N Middleware: BA_1_10.0.1.016_N Firmware: 7.35.205.8
PTT	3.1.35
Touch FW	27
RxLogger	5.4.13.0
Elemez (B2M client)	1.0.0.408
Bluetooth Pairing Utility	3.9
DataAnalytics	3.3.0.1113
File Browser	1.19.1.5
Enterprise Keyboard	2.1.1.3
Stage Now	3.4.1.5
App Gallery	3.0.1.7
User Guide	1
Sensors (Accel, Gyro)	3060105
MobiControl	N/A
Zebra Volume Control	2.0.0.13
Battery Manager	1.5.3
ActiveEdge	N/A
WorryFreeWifi (SmartMU)	N/A
Device Central	2.1.0.17
Audio	0.6.0.0
Diagnostic Tool	N/A
Ivanti Velocity	2.0.0.18010.9605437
FingerPrint	Zebra/WT6000/WT6000:7.1.1/02-12-29.00-NN-U12- STD/190919:user/release-keys
Security Patch Level	2019-10-05
Zebra Software Licensing	3.2.0



Event injection Service	1.0.0.5
GMS Version	N/A
Zebra Data Service	3.6.0.1034
WebView	97.0.4692.87

Requirements

- 1. Requires powered cradle with USB cable or USB Charge cable.
- 2. Requires Host PC computer.

Notes

- 1. The internal battery must be charged to at least 30% to update using recovery mode.
- 2. New reset packages are uploaded along with CFE v15.
 - reset packages version 2(released in August 2020) are supposed to be used for patch 15 and higher. If used on older patches, cache partition will not be formatted.
 - reset packages version 1(released in July 2018) are supposed to be used for patch 14 and lower.
 These packages will not work on newer patches due to downgrade protection check.
 - 3. ILI9805 display devices are not allowed to downgrade to any of the older BSPs or Lifeguard Patches below 21.
 - To identify the display type on WT6000 devices user can check the 'ro.config.device.display' property using adb getprop command.

For WT6000 ILI9805 device [ro.config.device.display]: [254] For WT6000 ILI9805C device [ro.config.device.display]: [250]

Full package update (WT6000_FULL_UPDATE_02-12-29.00-NN-U21-STD.zip) is mainly meant for WT6000 ILI9805 display devices as these devices are not allowed to downgrade to any of the older BSPs.

To identify the display type on WT6000 devices user can go to "Settings" → "About device" → "Hardware config" → "Display"

Ilitech-ILI9805: new display IC devices

Ilitech-ILI9805C: old display IC devices

Usage Notes

 The default mapping for the P3 key is configured as an ENTER command from LG 13 Onwards, on earlier LG it was mapped to Button_L2.



Known Issues

- "Draw Over Other Apps" grant permission screen might be observed only after performing Enterprise Reset from SOTI console.
- "Zebra Data Service plugin has stopped" or "Oeminfo has stopped "pop-up might be observed while downgrading from latest patch (LG13) to older patches.

Installation and setup instructions

Software update procedure

The installation instructions assume user have ADB installed on their PC (the adb drivers etc..) and the user device has developer options enabled and USB debugging ON.

Installation and setup instructions

Important Links

- https://developer.zebra.com/
- support central

About WT6000

For warehousing and manufacturing customers who want to improve worker productivity, the WT6000 offers industry leading ergonomics, a modern touch-centric user experience and time saving features, such as NFC tap to pair.

- 6% smaller and 27% lighter than the previous generation wearable computer, so more comfort and less fatigue for workers.
- NFC reader, for quick tap-to-pair with ring scanners, wireless headsets and mobile printers.
- All Touch TE, which enables seamless migration of legacy TE green screens to an intuitive touch screen interface.
- Shared PowerPrecision+ battery with the RS6000 ring scanner, for simplified battery management.